

Key Features



Applications

- 1.2 ~ 1.6 GHz
- 0.50 dB noise figure
- 18.0 dBm output IP₃
- 32.0 dB Gain
- 5.0 dBm P_{1dB}
- 1.35:1 VSWR
- Single Power Supply
- RoHS Compliant
- **MADE IN USA**

- Mobile Infrastructures
- GPS
- Avionics
- Measurement
- Fixed Wireless



Absolute Maximum Ratings


Parameters	Units	Rating
DC Voltage, 303N/303N-12	V	-0.5, 6/16V
Drain Current	mA	50
Total Power Dissipation	mW	300
RF Input Power	dBm	10
Channel Temperature	°C	150
Storage Temperature	°C	-55~125
Operating Temperature	°C	-40~85
Thermal Resistance	°C/W	220

Operation of this device above any one of these parameters may cause permanent damage.

Specifications

Summary of the electrical specifications WZA303N at room temperature

Index	Testing Item	Symbol	Test Constraints	Min	Nom	Max	Unit
1	Gain	S ₂₁	1.20 – 1.60 GHz	30	32		dB
2	Gain Variation	ΔG	1.20 – 1.60 GHz		+/- 0.5	+/-1.0	dB
3	Input Return Loss	S ₁₁	1.20 – 1.60 GHz	14	16		dB
4	Output Return Loss	S ₂₂	1.20 – 1.60 GHz	14	16		dB
5	Reverse Isolation	S ₁₂	1.20 – 1.60 GHz		45		dB
6	Noise figure	NF	1.20 – 1.60 GHz		0.5	0.65	dB
7	Output Power 1dB compression Point	P _{1dB}	1.20 – 1.60 GHz		5		dBm
8	Output-Third-Order Interception point	IP ₃	Two-Tone, P _{out} = 0 dBm each, 1 MHz separation		17		dBm
9	Current Consumption	I _{dd}	@ 25 °C		25		mA
10	Power Supply Voltage	V _{dd}	WZA303N	+4.7	+5.0	+5.3	V
			WZA303N-12	+8.0	+12	+16	
11	Thermal Resistance	R _{th,c}	Junction to case			220	°C/W
12	Operating Temperature	T _o	Case temperature at the bottom of the housing	-40		+85	°C
13	Maximum Average RF Input Power	P _{IN, MAX}	DC – 13 GHz			10	dBm
14	Spurious	P _{spur}	DC – 13 GHz	-70			dBc

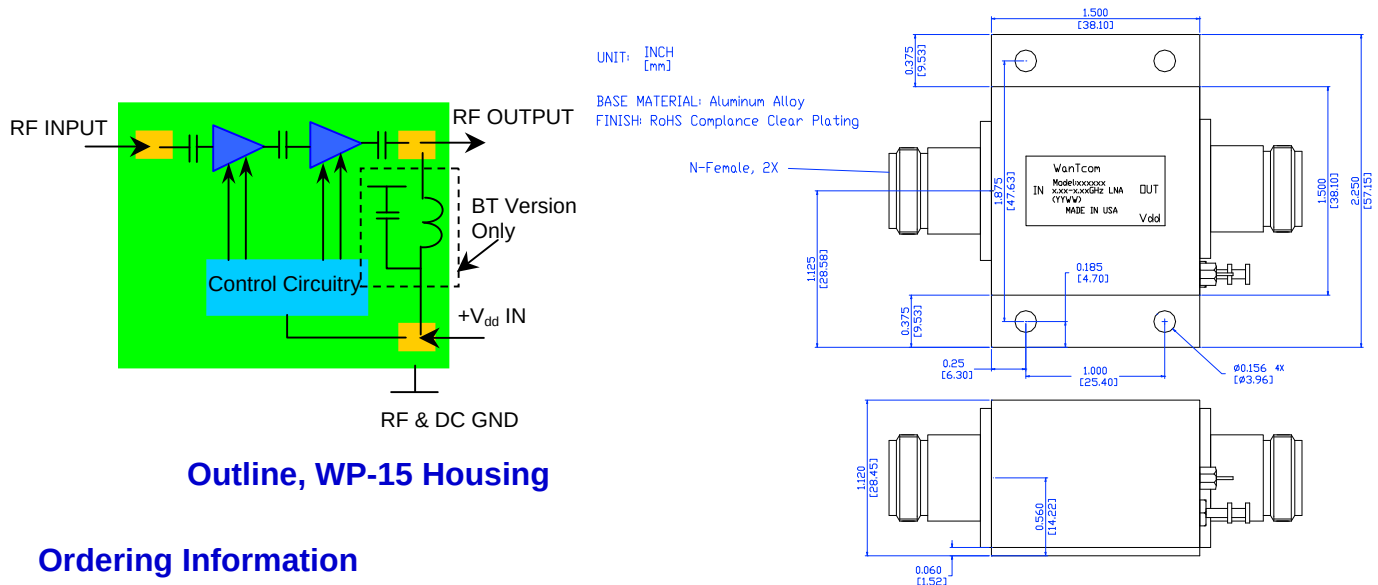


Ordering Information

Function	V _{dd} = +5V, No Bias-T	V _{dd} = +5V, With Bias-T	V _{dd} = +8 ~ +16V, No Bias-T	V _{dd} = +8 ~ +16V, With Bias-T
Model Number	WZA303N	WZA303NBT	WZA303N-12	WZA303N-12BT

Specifications and information are subject to change without notice.



Typical Performance

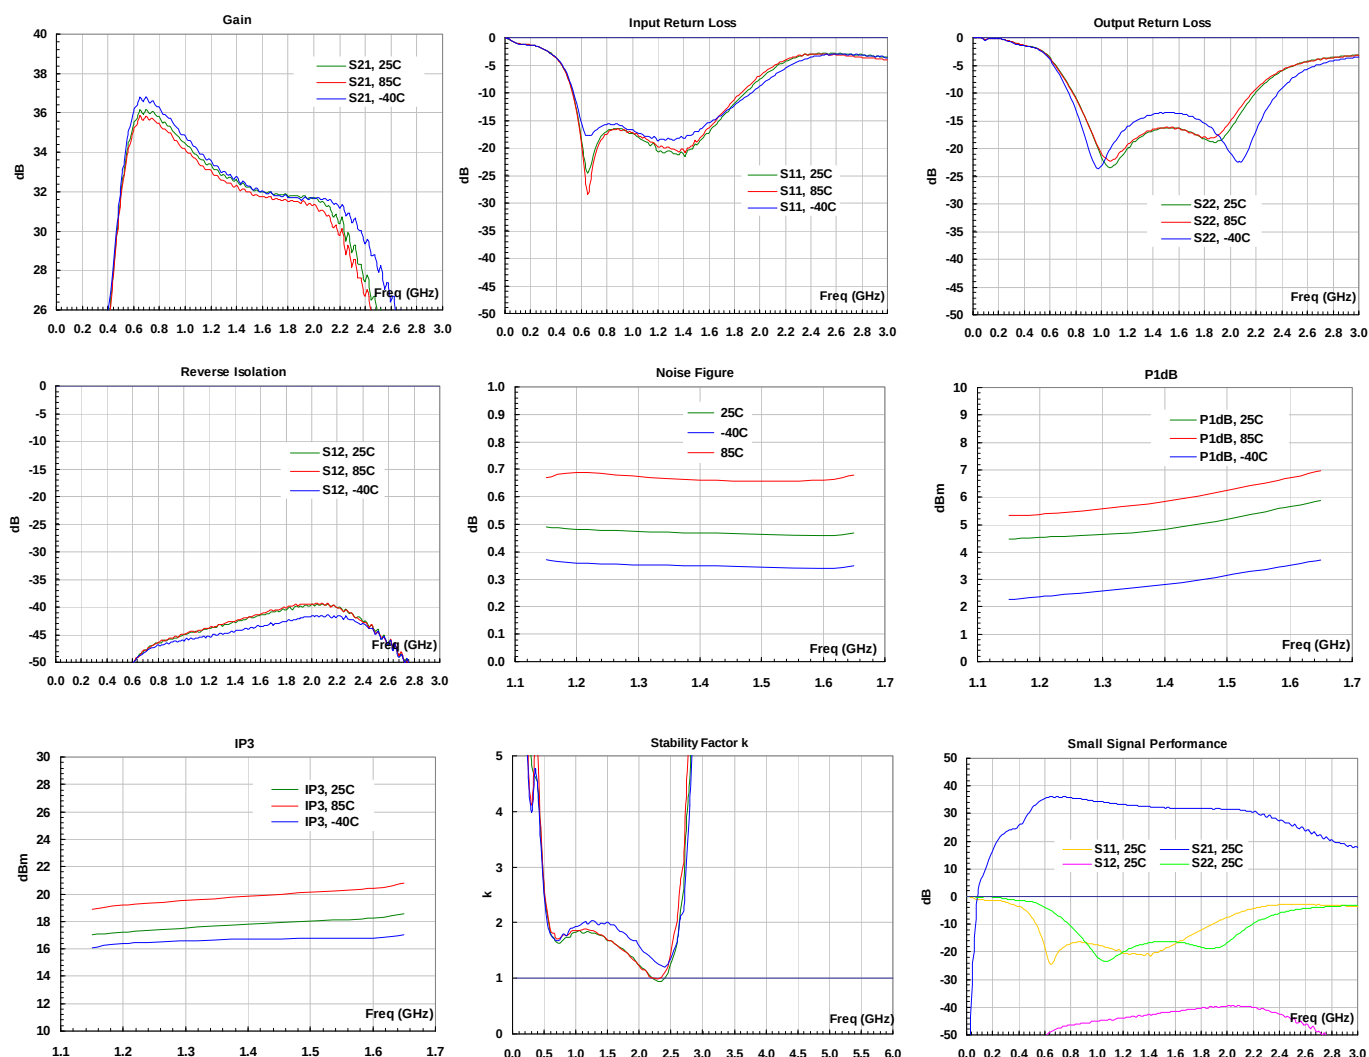

Application Notes:

A. N Connector Torque Wrench Selection

Always use a torque wrench with 8 ~10 inch-lb coupling torque setting for mating the N cables to the amplifier. Never use torque more than 12 inch-lb wrench for tightening the mating cable to the connector. Otherwise, the permanent damage will occur to the N connectors of the amplifier.

B. Mounting the Amplifier

Use three pieces of #4-40 screws for mounting the amplifier on a metal-based chase. Flat and spring washers are needed to prevent the screw loosening during the shock and vibration. Always use the appropriate torque setting of the power screwdriver to mount them.

Specifications and information are subject to change without notice.