
3DB / 2.3-2.7 GHZ

R431.111.241

Series: COUPLER

R431.111.241: R431.111.240 packaged in reel of 1000 couplers

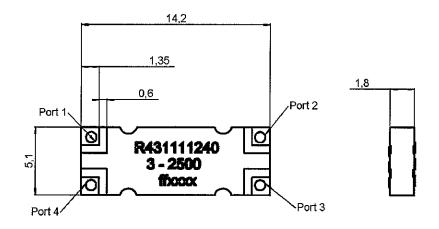


RF Port configuration

	Input	Isol.	-90°	0	
Port	1	2	3	4	
	2	1	4	3	
	3	4	1	2	
	4	3	2	1	



Scale 1:1

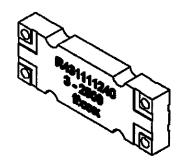

All dimensions are in mm.



Issue: 0450 C

In the effort to improve our products, we reserve the right to make changes judged to be



3DB / 2.3-2.7 GHZ

R431.111.241

Series: COUPLER

ELECTRICAL CHARACTERISTICS

		Specified band	Extended bar
Frequency (GHz)		2.3 - 2.7	2 - 3
V.S.W.R	≤	1.18	1.23
Impedance (Ω)		50	
Nominal coupling (dB)		3	3
Amplitude balance (dB)	±	0.2	0.4
Phase balance: 90 (°)	±	3	4
Isolation (dB)	≥	22	19
Insertion loss (dB)	≤	0.2	0.2
Average power at 25°C (W)		60	60

MECHANICAL CHARACTERISTICS

Mounting RF Port finish Weight

Surface Mount Technology SnPb 1.000 g

ENVIRONMENTAL

Operating temperature range

-55 / +85

 $^{\circ}\mathrm{C}$


Storage temperature range

-55 / +85

°C

SPECIFICATION

SOLDERING PATTERN

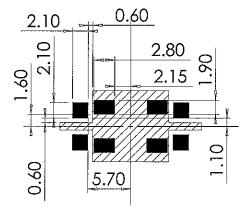

Issue: 0450 C


In the effort to improve our products, we reserve the right to make changes judged to be necessary.




3DB / 2.3-2.7 GHZ

R431.111.241

Series : COUPLER

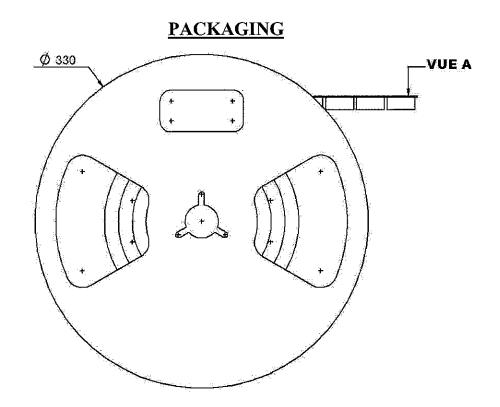

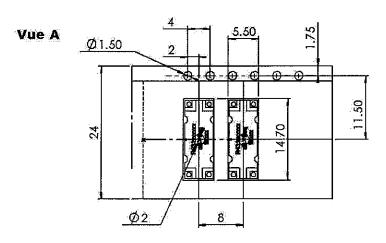

Issue: 0450 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.




3DB / 2.3-2.7 GHZ

R431.111.241

Series: COUPLER

SOLDERING GUIDELINES

(1) Solder cream deposition:




RADIALL recommends using a solder cream Sn 63 - Pb 35 - Ag 2 type "no clean - low residue" (50 % solid residue of flux quantity) that will permit the elimination of the cleaning operation step after soldering. When using a conventional solder cream with high level of flux solid residue, it is important to incorporate a good cleaning operation step in the fifteen minutes after soldering.

The substrate must have Sn 60 - Pb 40 protection. Please optically verify that the edges of the zones are clean, without contaminates and that the PCB zoned areas have not oxydated.

Solder cream may be applied on the board with screen printing or dispenser techniques. For either method, the paste solder must be coated to appropriate thickness and shapes to achieve good solder wetting and adequate insulation.

The design of the mounting pads and the stencilling area are given in the applicable note, for a thickness of the silk-screen printing of $150\,\mu m$.

(2) Placement of the coupler:



For small, lightweight components such as chip components, a self-alignment effect can be expected if small placement errors exist. However, this effect is not as expected for couplers components and they require precise positioning on their soldering pads; typically \pm 0.25 mm.


Place the coupler onto the PCB with automatic pick and place equipment. Various types of suction can be used.


RADIALL does not recommend using adhesive agents on the component or on the PCB.

Please follow RADIALL's recommended temperature profile.

This profile can be used with Infra-red reflow, Vapor phase soldering and Forced air convection.

3 Soldering:



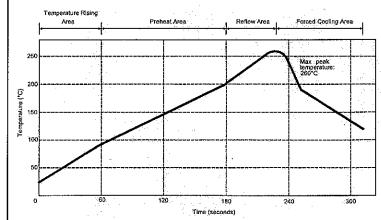

Parameter	Value	Unit
Temperature rising Area	1 - 4	°C/sec
Max Peak Temperature	260	°С
Max dwell time @260°C	10	sec
Min dwell time @235°C	20	sec
Max dwell time @235°C	60	sec
Temperature drop in cooling Area	-1 to -4	°C/sec
Max dwell time above 100°C	420	sec

Issue: 0450 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.




3DB / 2.3-2.7 GHZ

R431.111.241

Series : COUPLER






When using a conventional solder cream with high level of residue, please clean the PCB with a substitute product, similar to CFC, that complies to the International Environment Agency rules. It is important to do the cleaning operation step less than fifteen minutes after reflow.

RADIALL recommends using ultrasonic waves or vapor phase process.

5 Quality check:



Verify by visual inspection that component is centred on the mounting pads.

Solder joints: verify by visual inspection that the formation of meniscus on the pads are proper, and have a capitarity amount upper the third of the height.

Issue: 0450 C

In the effort to improve our products, we reserve the right to make changes judged to be

